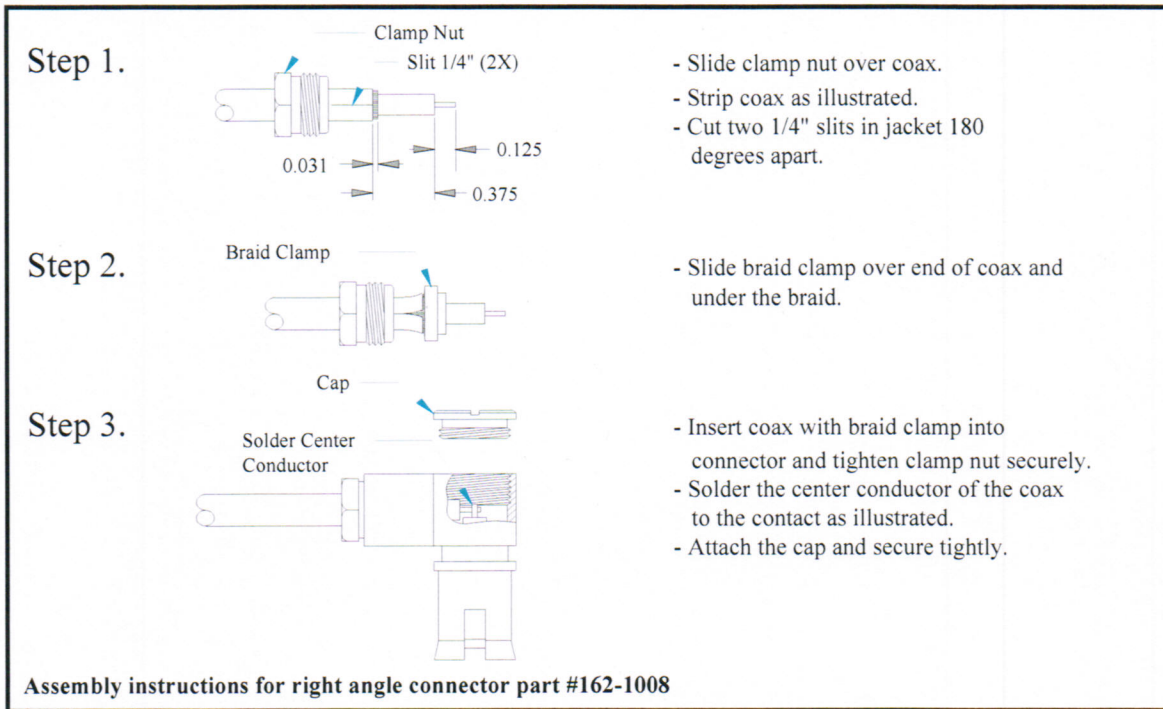


**Note:** The SL60 performance has been verified in typical installations and has not shown to have problems with the built-in comm interfering with the GPS when installed according to the recommended installation guidelines.

If a VHF comm transmitter causes problems with the GPS on the selected frequencies as listed in the post-installation checkout, the problem may be due to the ELT. This can be verified by disconnecting the ELT antenna coax at the ELT unit. If the ELT is found to cause the problem, then contact the ELT manufacturer or replace the ELT.



**Figure 6 Rear Coax Connector Assembly**